


SLOPED LADDER ARR.

DWG. #

LDW22428EA-ST

NOTES:

- LADDER AND BRACKETS SHIP LOOSE. FIELD INSTALLATION BY OTHERS IS REQUIRED.
- 2. REFER TO RIGGING PACK FOR LADDER AND PLATFORM MOUNTING INSTRUCTIONS.
- 3. RIG LADDER BEFORE INSTALLING PIPEWORK TO UNIT.

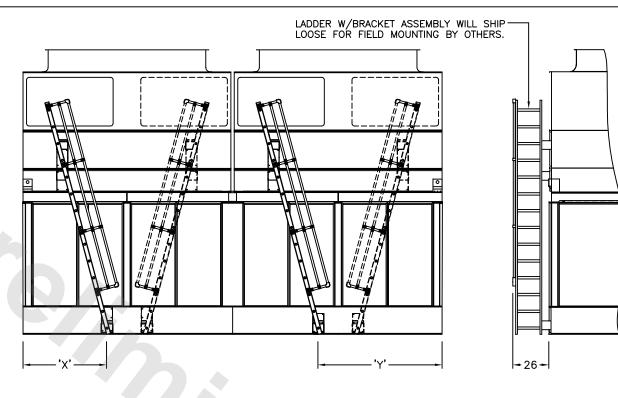

SIDE VIEW END VIEW

MODEL NUMBER		,,,,	* > *	
COOLER	CONDENSER	'X'	Y	
ATW 672-3L,3M	_	69 3/4	98	
ATW 672-4L,4M	_	71 7/8	95 7/8	
ATW 672-5M,5N	ATC 2256B,2324B	74 3/8	93 1/4	
ATW 672-6M,6N	ATC 2404B,2509B	76	91 5/8	
0110701150 11107111171011 110750				

CUSTOMER INSTALLATION NOTES:

- a. REMOVE LADDER BRACKET MOUNTING BOLTS (1) FROM LADDER MOUNTING CHANNELS (2) ON PAN AND CASING SECTIONS.
- b. LOOSEN, BUT DO NOT REMOVE, LADDER BRACKET AND ASSY. BOLTS (3).
- c. TO ASSÉMBLE, SLIDE LADDER BRACKET ASSY. (4) OVER LADDER MOUNTING CHANNELS (2) LOCATED ON PAN AND CASING (DO NOT REMOVE LADDER BRACKET ASSY. (4) FROM LADDER.)
- d. ALIGN HOLES AND REINSTALL LADDER BRACKET MOUNTING BOLTS (1) THROUGH LADDER BRACKET ASSY. (4) AND LADDER MOUNTING CHANNELS (2).
- e. TIGHTEN ALL BOLTS.
- f. TIGHTEN ADJUSTING SCREW (5) IN THE ADJUSTABLE MOUNTING BRACKETS WHEN APPLICABLE.

